





Принадлежности

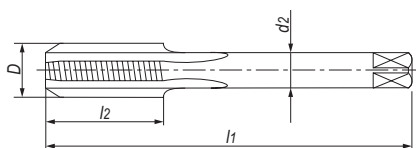


Материал	< 700	< 850	< 1000	< 1400	< 700	> 700	< 240	< 300	< 8% Si	> 8% Si	Латунь Медь	Бронза	Ni	Ti	< 55 HRC	< 60 HRC	< 65 HRC
HSSE-V3	●	●	●	●	●	●	●	●	●	●	●	●	●	●			

M	Шаг	l1	l2	d2	Приводной квадрат	Отверстие под резьбу	Артикул
M 2	0,4	36	8	2,8	2,1	1,6	131023 0020
M 2,5	0,45	40	9	2,8	2,1	2,05	131023 0025
M 3	0,5	40	11	3,5	2,7	2,5	131023 0030
M 4	0,7	45	13	4,5	3,4	3,3	131023 0040
M 5	0,8	50	16	6	4,9	4,2	131023 0050
M 6	1	50	19	6	4,9	5	131023 0060
M 8	1,25	56	22	6	4,9	6,8	131023 0080
M 10	1,5	70	24	7	5,5	8,5	131023 0100
M 12	1,75	75	29	9	7	10,2	131023 0120
M 14	2	80	30	11	9	12	131023 0140
M 16	2	80	32	12	9	14	131023 0160
M 18	2,5	95	34	14	11	15,5	131023 0180
M 20	2,5	95	34	16	12	17,5	131023 0200
M 24	3	110	38	18	14,5	21	131023 0240



Принадлежности

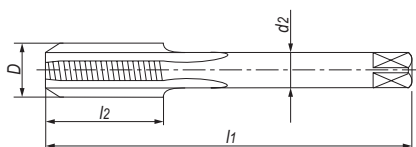

Материал	< 700	< 850	< 1000	< 1400	< 700	> 700	< 240	< 300	< 8% Si	> 8% Si	Латунь Медь	Бронза	Ni	Ti	< 55 HRC	< 60 HRC	< 65 HRC
HSSE-PM	●	●	●	●	●	●	●	●	●	●	●	●	●	●			

M	Шаг	l1	l2	d2	Приводной квадрат	Отверстие под резьбу	Артикул
M 3	0,5	40	11	3,5	2,7	2,5	131024 0030
M 4	0,7	45	13	4,5	3,4	3,3	131024 0040
M 5	0,8	50	16	6	4,9	4,2	131024 0050
M 6	1	50	19	6	4,9	5	131024 0060
M 8	1,25	56	22	6	4,9	6,8	131024 0080
M 10	1,5	70	24	7	5,5	8,5	131024 0100
M 12	1,75	75	29	9	7	10,2	131024 0120
M 16	2	80	32	12	9	14	131024 0160
M 20	2,5	95	34	16	12	17,5	131024 0200
M 24	3	110	38	18	14,5	21	131024 0240