


Принадлежности




Материал	< 700	< 850	< 1000	< 1400	< 700	> 700	< 240	< 300	< 8% Si	> 8% Si	Латунь Медь	Бронза	Ni	Ti	< 55 HRC	< 60 HRC	< 65 HRC
HSS	●	●	●	●	●	●	●	●	●	●	●	●	●	●			

M	Шаг	l1	l2	d2	Приводной квадрат	Отверстие под резьбу	Артикул
M 2	0,4	36	8	2,8	2,1	1,6	131009 0020
M 2,5	0,45	40	9	2,8	2,1	2,05	131009 0025
M 3	0,5	40	11	3,5	2,7	2,5	131009 0030
M 4	0,7	45	13	4,5	3,4	3,3	131009 0040
M 5	0,8	50	16	6,0	4,9	4,2	131009 0050
M 6	1	56	19	6,0	4,9	5	131009 0060
M 8	1,25	63	22	6,0	4,9	6,8	131009 0080
M 10	1,5	70	24	7,0	5,5	8,5	131009 0100
M 12	1,75	75	28	9,0	7,0	10,2	131009 0120
M 14	2	80	30	11,0	9,0	12	131009 0140
M 16	2	80	32	12,0	9,0	14	131009 0160
M 18	2,5	95	34	14,0	11,0	15,5	131009 0180
M 20	2,5	95	34	16,0	12,0	17,5	131009 0200
M 22	2,5	100	40	18	14,5	19,5	131009 0220
M 24	3	110	50	18	14,5	21	131009 0240
M 27	3	110	50	20	16	24	131009 0270
M 30	3,5	125	56	22	18	26,5	131009 0300

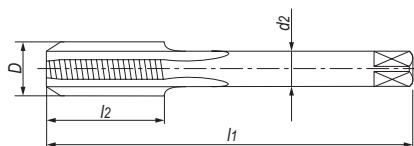

Принадлежности

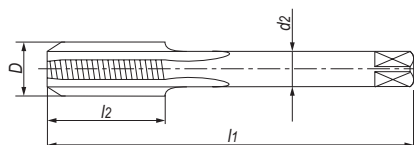

Материал	< 700	< 850	< 1000	< 1400	< 700	> 700	< 240	< 300	< 8% Si	> 8% Si	Латунь Медь	Бронза	Ni	Ti	< 55 HRC	< 60 HRC	< 65 HRC
HSSE-VAP	●	●	●	●	●	●	●	●	●	●	●	●	●	●			

M	Шаг	l1	l2	d2	Приводной квадрат	Отверстие под резьбу	Артикул
M 2	0,4	36	8	2,8	2,1	1,6	131014 0020
M 2,5	0,45	40	9	2,8	2,1	2,05	131014 0025
M 3	0,5	40	11	3,5	2,7	2,5	131014 0030
M 4	0,7	45	13	4,5	3,4	3,3	131014 0040
M 5	0,8	50	16	6	4,9	4,2	131014 0050
M 6	1	50	19	6	4,9	5	131014 0060
M 8	1,25	56	22	6	4,9	6,8	131014 0080
M 10	1,5	70	24	7	5,5	8,5	131014 0100
M 12	1,75	75	29	9	7	10,2	131014 0120
M 14	2	80	30	11	9	12	131014 0140
M 16	2	80	32	12	9	14	131014 0160
M 18	2,5	95	34	14	11	15,5	131014 0180
M 20	2,5	95	34	16	12	17,5	131014 0200
M 22	2,5	100	34	18	14,5	19,5	131014 0220
M 24	3	110	38	18	14,5	21	131014 0240